



**ROHDE & SCHWARZ**

Test and Measurement  
Division

## Release Notes

# Firmware Update R&S<sup>®</sup> ESIB 4.35

for R&S<sup>®</sup> ESIB7, R&S<sup>®</sup> ESIB26, R&S<sup>®</sup> ESIB40

# Contents

<b>1</b>	<b>General Information .....</b>	<b>3</b>
	Manuals for R&S ESIB Family.....	3
<b>2</b>	<b>Firmware Update .....</b>	<b>4</b>
	System Requirements .....	4
	Preparations for Update .....	4
	Contents of Firmware Update Kit .....	4
	Update Procedure .....	4
<b>3</b>	<b>Modifications concerning the Operating Manual.....</b>	<b>7</b>
	Frequency step size as percent value .....	7
	Probe ON OFF softkey in Transducer Menu.....	8
	CISPR AV-Detektor.....	9
	CISPR RMS-Detektor.....	9
<b>4</b>	<b>Faults Remedied in Version V4.34.3.....</b>	<b>12</b>
<b>5</b>	<b>Faults Remedied in Version V4.34.4.....</b>	<b>12</b>
<b>6</b>	<b>Faults Remedied in Version V4.34.5.....</b>	<b>12</b>
<b>7</b>	<b>Faults Remedied in Version V4.35.....</b>	<b>12</b>
<b>8</b>	<b>Known Problems .....</b>	<b>13</b>
<b>9</b>	<b>Appendix: Contact to our hotline .....</b>	<b>14</b>

## 1 General Information

### Manuals for R&S ESIB Family

The instruments of the R&S ESIB family are supplied with the following manuals:

*Operating Manual, EMI Test Receiver R&S ESIB7, R&S ESIB26, R&S ESIB40; Order No. 1088.7531.xx-03*

where xx = 11 (German)  
12 (English)  
19 (English, US letter format)  
13 (French)

*„Service Manual – Instrument EMI Test Receiver R&S ESIB7, R&S ESIB26, R&S ESIB40; Order No. 1088.7531.xx-03-*

where xx = 81 (German)  
82 (English)  
89 (English, US letter format)

*Operating Manual, Vector Signal Analyzer FSE-B7 (Option), Order No. 1066.4323.xx-07-*

where xx = 11 (German)  
12 (English)

*Operating Manual, External Mixer Output FSE-B21, Order No. 1084.7350.xx-02-*

where xx = 15 (German, English and French)  
19 (English, US letter format, -02-)

*Manual, Harmonic Mixer, FS-Zxx, Order No. 1089.0982.xx-02-*

where xx = 35 (German, English and French)  
39 (English, US letter format, -02-)

## 2 Firmware Update

The update instructions given in this section are up to date; any deviating instructions in the operating manual are to be ignored.

### System Requirements

None

### Preparations for Update

No preparations are required.

### Contents of Firmware Update Kit

The update kit comprises the following:

- Seven 3.5"/1.44 Mbyte disks labeled as follows:
  - Disk 1 : „V4.35 DISK 1“
  - Disk 2 : „V4.35 DISK 2“
  - Disk 3 : „V4.35 DISK 3“
  - Disk 4 : „V4.35 DISK 4“
  - Disk 5 : „V4.35 DISK 5“
  - Disk 6 : „V4.35 DISK 6“
  - Disk 7 : „V4.35 DISK 7“
- This document

### Update Procedure

#### 1. If you have received a self-extracting archive file per e-mail or as a download ...

a set of disks must first be created from the archive file.

#### Proceed as follows:

- Check if you have received all files
  - disk1.bin self extracting ZIP file, used to generate update disk 1
  - data2.cab packed contents of disk 2, automatically unpacked during FW update
  - data3.cab packed contents of disk 3, automatically unpacked during FW update
  - data4.cab packed contents of disk 4, automatically unpacked during FW update
  - data5.cab packed contents of disk 5, automatically unpacked during FW update
  - data6.cab packed contents of disk 6, automatically unpacked during FW update
  - data7.cab packed contents of disk 7, automatically unpacked during FW update
- Keep seven DOS-formatted 3.5" / 1.44 Mbyte disks ready.
- Label disks as follows
  - ESIB V4.35 DISK1
  - ESIB V4.35 DISK2
  - ESIB V4.35 DISK3
  - ESIB V4.35 DISK4
  - ESIB V4.35 DISK5
  - ESIB V4.35 DISK6
  - ESIB V4.35 DISK7

- Create a temporary directory on your PC (e.g. ESIBTEMP on C:\). For this you require about 14 Mbyte free memory capacity on your hard disk.
- Copy file disk1.bin to this temporary directory
- Rename file disk1.bin to disk1.exe
- Execute disk1.exe, e.g. by using the following command sequence for Windows95/NT:
  - <CTRL><ESC> - RUN – C:\ESIBTEMP\DISK1 - <ENTER> (English version) or
  - <CTRL><ESC> - AUSFÜHREN – C:\ESIBTEMP\DISK1 - <ENTER> (German version)

The files are extracted.

- Delete file disk1.exe in the temporary directory.  
The temporary directory should contain the following files:
 

_inst32i.ex_	_isdel.exe	_setup.dll	_sys1.cab	_user1.cab
data.tag	data1.cab	dskcount.txt	lang.dat	layout.bin
os.dat	readme.txt	setup.exe	setup.ini	setup.ins
setup.iss	setup.lid			
- Copy all files to update disk 1 (ESIB V4.35 DISK1).  
Check if all files are on the disk with their correct names. In particular, the underscores ("\_" as in "\_inst32iex\_") are essential for a successful update.
- The contents of the other 6 disks are already in the format needed for the update. Files data2.cab, data3.cab, ..., data7.cab must be copied to the corresponding disks DISK2, DISK3, ..., DISK7 .

The disks are now ready, and you can continue with section 2 "If you have received a firmware update kit on a disk ...".

**Notes:** *If any error messages are output during creation of a disk, the installation process for the disk in question must be repeated. Before re-creating the disk, check if the write protection has been removed.*

## 2. If you have received a firmware update kit on a disk ...

You can load the firmware directly from the disk to your instrument.

- Insert the disk DISK 1 into the drive.
- Press the SETUP key and change to the side menu by pressing ⇒ key.
- Press the FIRMWARE UPDATE softkey.
- Start the update by pressing the UPDATE softkey and follow the instructions on the instrument display.

First, the contents of the update disks are copied to the hard disk of the instrument. Then the files are extracted and copied in the directories accordingly. After the extraction, the instrument is rebooted.

The firmware update is complete.

The previous firmware version may be restored using softkey *RESTORE*.  
Perform a total calibration (CAL - CAL TOTAL menu) after the firmware update.

### 3. If problems occur during the firmware update ...

The new firmware can also be loaded under NT if necessary. This should be done only with an external keyboard and a mouse. Log-in has to be made using the ADMINISTRATOR function, and the device firmware has to be terminated.

Log in as administrator. This procedure is described in the operating manual (PC function), too.

- Press key combination ALT SYSREQ to switch to NT screen if not yet displayed.
- Call up the NT task bar START – SHUT DOWN.
- Select 'Close all programs and logon as different user'.
- Hold the SHIFT key down and press the YES key to leave the input window until the login window appears.
- Release the SHIFT key as soon as the login window appears.
- Now enter administrator as user name and 894129 as password.

Terminate the device firmware:

- Press the keys CTRL ALT DEL on the external keyboard simultaneously.
- Select the Task Manager.
- Select the Application R&S Analyzer Instrument and terminate it with End Task.

Now the new firmware can be loaded:

- Insert DISK 1 into drive A:
- Start the installation with START RUN A:SETUP. You will be prompted to insert the remaining disks one after the other.

After loading the software, the operating system is rebooted. Then change back from administrator to instrument (password instrument) for the login (see operating manual). This is done in the same way as changing of login to administrator.


**Note:** *If the firmware is installed in this way, the previous version cannot be restored.*

### 3 Modifications concerning the Operating Manual

The new firmware offers extensions and improvements which are not yet described in the operating manual:


#### Frequency step size as percent value

The step size menu of the receiver frequency has been enhanced by several softkeys. These softkeys define the step size as percent value of the selected resolution bandwidth (RBW).

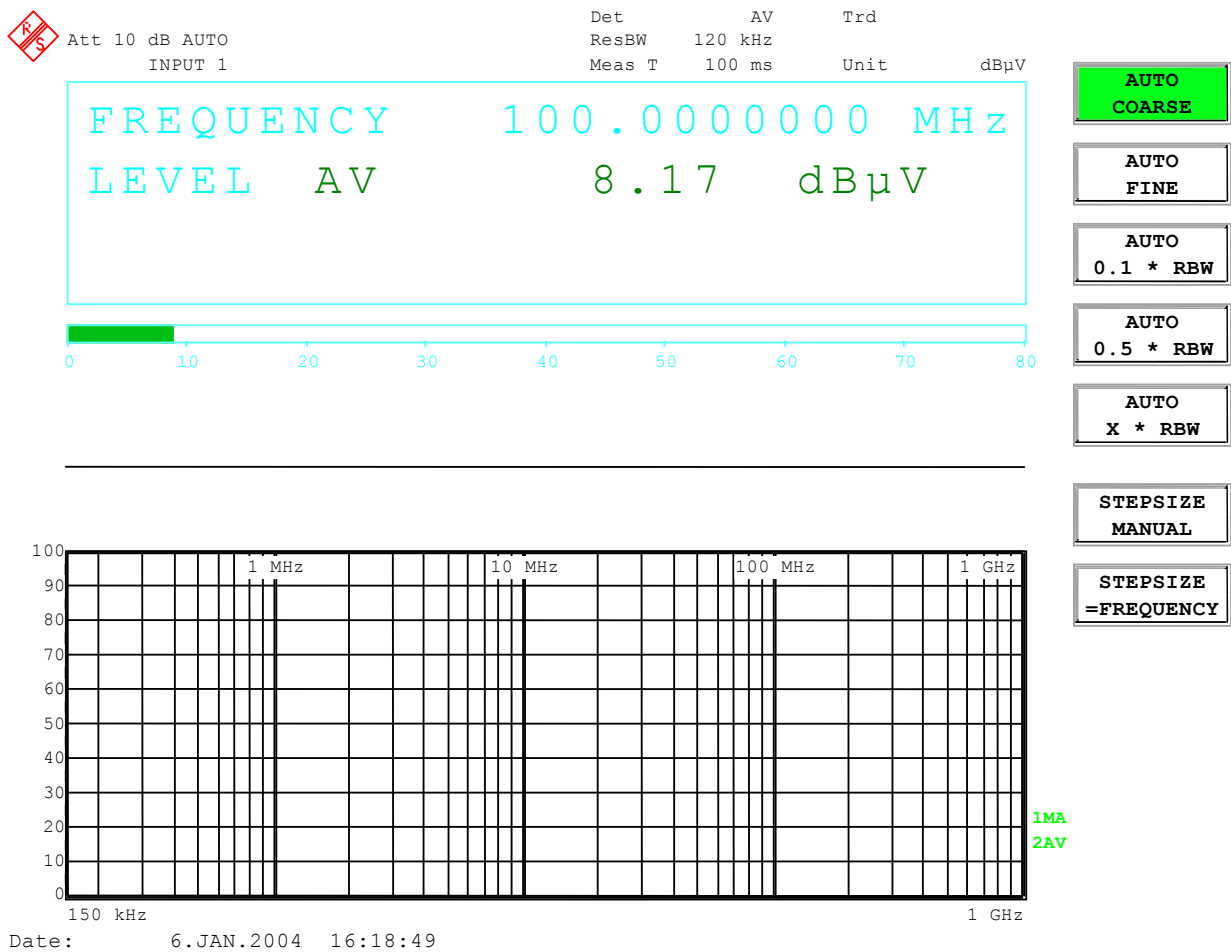

### Probe ON OFF softkey in Transducer Menu

 The PROBE CODE ON OFF softkey has been added to the Transducer menu.



The *PROBE CODE ON/OFF* softkey enables or disables the units defined by the coded connector.

IEC/IEEE bus command :UNIT:PROBe ON | OFF

Att 10 dB AUTO Det AV Trd  
ResBW 120 kHz

**ACTIVE TRANSDUCER FACTOR** dBμA

Name: NONE Freq range:  
Unit: to:

Comment:

TRANSDUCER FACTOR		TRANSDUCER SET	
Name	Unit	Name	Unit
6DB	dB	3M_SWB	
MEAS_1M	dB		
MEAS_2M	dB		
MEAS_3M	dB		
MEAS_3M5	dB		
SLINE_2	dB		
SLINE_3	dB		
SLINE_LT	dB		

100  
90  
80  
70  
60  
50  
40  
30  
20  
10  
0

150 kHz 10 MHz 1 GHz

Date: 6.JAN.2004 16:22:21

1MA  
2AV

### CISPR AV-Detektor


The weighting mode CISPR AV can be used with the 1 MHz IF bandwidth.

	CISPR Band A	CISPR Band B	CISPR Band C/D	CISPR Band E
Frequency range	9 kHz to 150 kHz	150 kHz to 30 MHz	30 MHz to 1000 MHz	> 1000 MHz
IF bandwidth	200 Hz	9 kHz	120 kHz	1 MHz
Lowpass time constant	160 ms	160 ms	100 ms	100 ms

### CISPR RMS-Detektor

The weighting modes that can be selected have been extended by the detector CISPR RMS.

CONFIGURATION MODE - EMI RECEIVER menu:


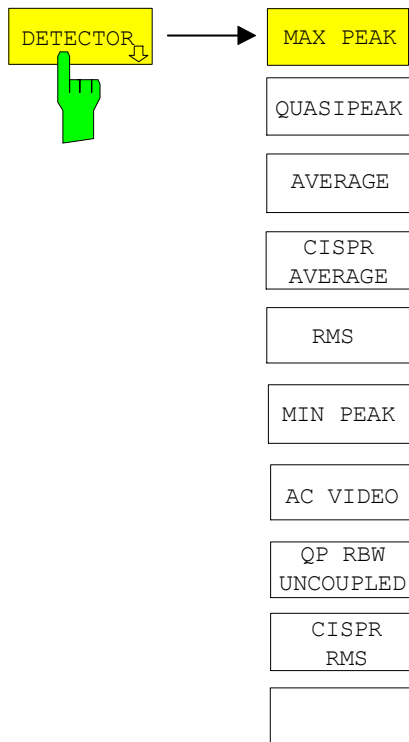


The *DETECTOR* softkey opens a submenu to select the detector.

Multiple detection is activated by switching on up to four single detectors. The MIN PEAK, RMS and AC VIDEO detector cannot be switched on simultaneously.

Softkey *AC VIDEO* is available only if the instrument is equipped with the linear video output (option ESIB-B1).

TRACE menu

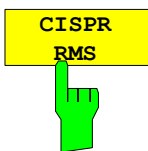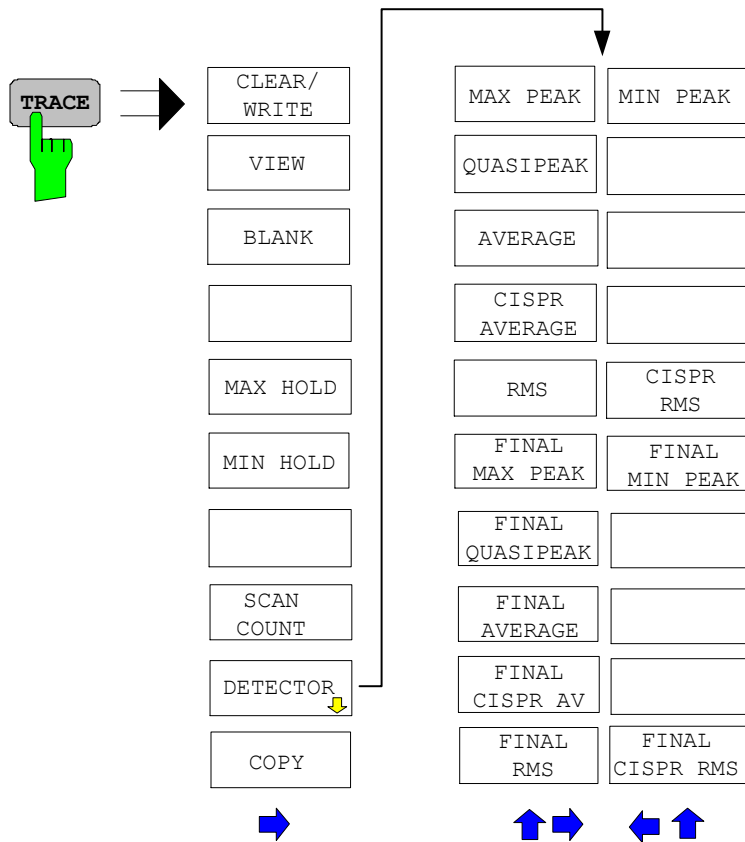

The *CISPR RMS* softkey activates the weighting detector according to a proposed amendment of CISPR 16-1-1 (CISPR/A/628/CD). The CISPR RMS average detector supplies a weighted reading of the input signal. When measuring the RMS-average according to the proposed amendment of CISPR 16-1-1, the maximum value of the RMS-average during the measurement time is displayed. The detector is used, for example, to measure pulsed sinusoidal signals with a low pulse repetition frequency. It is calibrated with the RMS value of an unmodulated sinusoidal signal. Averaging is with lowpass filters of the 2nd order (simulation of a mechanical instrument).

IEC/IEEE bus command :SENS:DET CRMS  
:SENS:DET:REC CRMS



The *FINAL CISPR RMS* softkey selects the weighting rms detector according to CISPR 16-1-1 for the final measurement.

IEC/IEEE bus command :SENS:DET:FME CRMS

	<b>CISPR Band A</b>	<b>CISPR Band B</b>	<b>CISPR Band C/D</b>	<b>CISPR Band E</b>
Frequency range	9 kHz to 150 kHz	150 kHz to 30 MHz	30 MHz to 1000 MHz	> 1000 MHz
IF bandwidth	200 Hz	9 kHz	120 kHz	1 MHz
Lowpass time constant	160 ms	160 ms	100 ms	100 ms
Corner frequency	10 Hz	100 Hz	100 Hz	1 kHz

## 4 Faults Remedied in Version V4.34.3

### Overload with CISPR Average Detector

The overload display is now cleared when the overload condition is removed.

### Operating mode change with high signal level

The displayed reference level could be wrong when switching from receiver mode to spectrum analyzer with a signal that caused an overload condition.

## 5 Faults Remedied in Version V4.34.4

### Slow scan progress with measurement times greater than 1 ms

Using the QP (or Max Peak or AV) Detector the scan speed could be very low with measurement times greater than 1 ms. The problem is fixed now.

### Spike in scan noise floor at 7 GHz, when preamp is switched off

If in a scan range up to 7 GHz the preamplifier was switched on, there could be a spike in the noise floor at exactly 7 GHz. The problem is fixed now.

### Units in transducer factor table not shown

In the transducer factor table sometimes units of transducer factors on the second or following pages were not shown. The problem is fixed now.

### Scan does not complete

Under rare conditions a scan did stop before reaching its end. The problem could not be seen on all instruments. The problem is fixed now.

## 6 Faults Remedied in Version V4.34.5

### Peak Detector

Under certain conditions the Peak detector could have a too short observation time when scanning.

### Spurious at 7 GHz

A spurious could be visible at 7 GHz when sweeping at certain frequency ranges with logarithmic frequency axis and preselector switched on.

## 7 Faults Remedied in Version V4.35

### Displayed Level at 7 GHz

When manually tuning the receiver at 7 GHz the displayed level could be different depending on the direction of frequency variation.

## **8 Known Problems**

### **Error with IEEE-Bus file transfer using repeat addressing**

If "repeat addressing" is selected for the controller of the IEEE Bus, some bytes may be corrupted when transferring files by low level commands via the IEEE bus from the R&S ESIB to the controller computer. This error happens only if the following conditions hold:

- repeat addressing
- block size less than 4096 bytes
- large files (approximately more than 400 kB)

The problem can be avoided by either disabling repeat addressing, or by setting the block size to at least 4096 bytes.

## 9 Appendix: Contact to our hotline

Any questions and ideas concerning the instrument are welcome to our hotline:

### USA & Canada

Monday to Friday (except US public holidays)  
8:00 AM – 8:00 PM Eastern Standard Time (EST)  
Tel. from USA 888-test-rsa (888-837-8772) (opt 2)  
From outside USA +1 410 910 7800 (opt 2)  
Fax +1 410 910 7801  
E-mail [Customer.Support@rsa.rohde-schwarz.com](mailto:Customer.Support@rsa.rohde-schwarz.com)

### East Asia

Monday to Friday (except Singaporean public holidays)  
8:30 AM – 6:00 PM Singapore Time (SGT)  
Tel. +65 6 513 0488  
Fax + 65 6 846 1090  
E-mail [Customersupport.asia@rohde-schwarz.com](mailto:Customersupport.asia@rohde-schwarz.com)

### Rest of the World

Monday to Friday (except German public holidays)  
08:00 – 17:00 Central European Time (CET)  
Tel. from Europe +49 (0) 180 512 42 42  
From outside Europe +49 89 4129 13776  
Fax +49 (0) 89 41 29 637 78  
E-mail [CustomerSupport@rohde-schwarz.com](mailto:CustomerSupport@rohde-schwarz.com)